

Multi-Point Inspection Checklist

RO# 6019850

Did your Service Advisor review the results of this multi-point inspection checklist with you?

Customer Name INVENTORY: 964680

Advisor Name JAKE BACHTELL

Technician Name Justen Shelman

Created on 9/11/2024 9:45 AM

Printed on 9/20/2024

☒ Checked and OK at this time

☐ May Require Future Attention

☐ Requires immediate attention

Maintenance Service

- ☒ ☐ ☐ Cold Engine start-up Pass
- ☒ ☐ ☐ Engine operation warm-up Pass
- ☒ ☐ ☐ Engine at normal operating temperature Pass
- ☒ ☐ ☐ Brake and parking operation Pass
- ☒ ☐ ☐ Active seat belt test Pass
- ☒ ☐ ☐ Clutch and transmission operations Pass
- ☒ ☐ ☐ Overdrive operation Pass
- ☒ ☐ ☐ Transfer case operation (4-wheel drive only) AWD
- ☒ ☐ ☐ Steering operation and off center Pass
- ☒ ☐ ☐ Front end alignment Pass
- ☒ ☐ ☐ Tilt steering wheel operation Pass
- ☒ ☐ ☐ Windshield wiper and washer operation at all speeds, wiper blade condition Pass
- ☒ ☐ ☐ Speedometer and odometer operation Pass
- ☒ ☐ ☐ Cruise Control operation, including resume Pass
- ☒ ☐ ☐ Heater and air condition operation Pass
- ☒ ☐ ☐ Abnormal noises and vibrations Pass
- ☒ ☐ ☐ Squeaks and rattles Pass
- ☒ ☐ ☐ Frame Check Pass
- ☒ ☒ ☐ Body surface, lower body, and upper body damage requiring body shop repair
FRONT LIC PLATE BRACKET MISSING, IN REAR
- ☒ ☒ ☐ Tire defects and damage, 5/32 FRONT AT 2/32, REAR AT 3/32
- ☒ ☐ ☐ Drive shaft, joints, CV's and boots Pass
- ☒ ☐ ☐ Struts/shock absorbers, leaks and wear Pass
- ☒ ☐ ☐ Exhaust system leaks and damage, including catalytic converter Pass
- ☒ ☐ ☐ Fuel, oil, coolant, or other fluid leaks Pass
- ☒ ☐ ☐ Perform emissions test and/or state inspection if required Pass
- ☒ ☐ ☐ Under hood labels and decals Pass
- ☒ ☒ ☐ Air filter and In-Cabin Air Filter equipped BOTH DIRTY
- ☒ ☐ ☐ Battery cables and mount Pass
- ☒ ☐ ☐ Coolant level and test Pass
- ☒ ☐ ☐ Under hood fluid levels, including transmission and transfer case fluids Pass
- ☒ ☐ ☐ Drive belts and hoses Pass
- ☒ ☐ ☐ Air conditioning levels, check at sight glass Pass
- ☒ ☐ ☐ Warning lights (including air bag) gauges & horn Pass
- ☒ ☐ ☐ Headlights, instrument lights, turn signals, flashers, brake lights, side marker lights, taillights, back up lights, and license plate light Pass

- ☒ ☐ ☐ Inside and outside rearview mirror operation, adjustment, and condition Pass
- ☒ ☐ ☐ Glass free of cracks, starts and large chips Pass
- ☒ ☐ ☐ Dome , courtesy, map and sun visor lights and lighters and power ports Pass
- ☒ ☐ ☐ Window operation Pass
- ☒ ☐ ☐ Sunroof or convertible top operation N/A
- ☒ ☐ ☐ Audio system and clock (set if required) Pass
- ☒ ☐ ☐ Factory -installed alarm system functional Pass
- ☒ ☐ ☐ Cigarette lighter operation, replace element if used Pass
- ☒ ☐ ☐ Headliner, sun visors, dash pad, upholstery, console, cup holder, trim panels, carpets Pass
- ☒ ☐ ☐ Truck bed, bed liner, tailgate, rear bumper Pass
- ☒ ☐ ☐ Door and door key/lock operation, including rear deck on wagons, child safety door locks are in normal (off) position Pass
- ☒ ☐ ☐ Seats and seat belt operation for every position Pass
- ☒ ☐ ☐ Rear defogger, check with test lights Pass
- ☒ ☐ ☐ Headlight aim Pass
- ☒ ☐ ☐ Trunk light and trunk trim appearance Pass
- ☒ ☐ ☐ Hood, trunk, and fuel filler door latch Pass
- ☒ ☐ ☐ Spare tire pressure, jack and tire wrench match vehicle and work properly Pass
- ☒ ☐ ☐ Wheel covers and caps Pass
- ☒ ☐ ☐ Pull four wheels and check brakes for minimum 50% remaining wear on pads/shoes. Inspect rotors/drums for minimum thickness FRONT AT 7MM, REAR AT 8MM
- ☒ ☐ ☐ Differential oil level Pass
- ☒ ☐ ☐ Engine oil and filter changed using genuine replacement parts Pass
- ☒ ☐ ☐ CHECK AND COMPLETE ALL OPEN RECALL Pass
- ☒ ☐ ☐ OTHER
- ☒ ☐ ☐ Deery Brothers has made every effort to inspect this vehicle and inform the customer of the condition of this vehicle. Pass
- ☒ ☐ ☐ With the complexity of the modern automobile, no one can foresee what may happen to it at any time. pass
- ☒ ☐ ☐ Deery Brothers makes no warranty, promise or guarantee that this inspection has caught every flaw that exists. Pass
- ☒ ☐ ☐ Deery Brothers welcomes a customers' request to have their own mechanic inspect this vehicle prior to purchase. Pass
- ☒ ☐ ☐ Customer Acknowledgement: Pass

964680

Technician _____ Date _____

Service Manager _____ Date _____

Used Car Manager _____ Date _____

Customer _____ Date _____

REPAIR ORDER - AUDIT COPY

DEERY BROTHERS
200 S Gear Ave
West Burlington, IA 52655

Year	Make	Model	Work Phone	R/O Open Date	R/O Number
2022	NISSAN	PATHFINDER	Home Phone	9/11/24	6019850/1
Vehicle Identification Number			Body	R/O Close Date	Receipt No.
5N1DR3CC8NC203833			SL 4WD	9/19/24	Original
Color			License Number	Mileage In	Mileage Out
RED				35672	35672
			Account No.	Service Advisor	
				JAKE BACHTELL	
				Delivery Date	In-Service Date

INVENTORY: 964680

#1 - 1: CHANGE ENGINE OIL AND OIL FILTER LUBE CHASSIS FILL ALL FLUID LEVELS Corrected by 1: CHANGE ENGINE OIL AND OIL FILTER LUBE CHASSIS FILL ALL FLUID LEVELS Work performed by Tech 490/ 0.40hrs @ 184.25 73.70 19420060 : N-OIL (08800-BOPCK) 5@8.10 40.50 1520865F0E : OIL FILTER 1@6.90 6.90 PERFORMED 5K SERVICE			I	
#2 - 4: 56 POINT INSPECTION Corrected by 4: 56 POINT INSPECTION Work performed by Tech 490/ 1.00hrs @ 169.95 169.95 PERFORMED 56 PT INSPECTION			I	
#3 - ALIGN: DEERY BROTHERS COMPUTERIZED ALIGNMENT SERVICE IN CLUDES SETTING CASTER AND CAMBER AND TOE IF ADJUST ABLE. DOES NOT INCLUDE REPLACEMENT OF DAMAGED OR R USTED COMPONENTS AND OR PART REPLACEMENT . Corrected by ALIGN: DEERY BROTHERS COMPUTERIZED ALIGNMENT SERVICE . IN CLUDES SETTING CASTER AND CAMBER AND TOE IF ADJUST ABLE. DOES NOT INCLUDE REPLACEMENT OF DAMAGED OR R USTED COMPONENTS AND OR PART REPLACEMENT . Work performed by Tech 490/ * 1.60hrs 149.95 PERFORMED ALIGNMENT			I	
#4 - RECALL: CHECK FOR OPEN RECALLS			I	
#5 * ICF: REPLACED IN CABIN AIR FILTER *CABIN AIR FILTER REPLACEMENT Corrected by ICF: REPLACED IN CABIN AIR FILTER Work performed by Tech 490/ * 0.10hrs 10.00 CAF15027C : CABIN FILTER 1@39.95 39.95 REPLACED FILTER			I	
#6 * AF: REPLACED ENGINE AIR FILTER *ENGINE AIR FILTER			I	

	INTERNAL	SERVICE CONT.	WARRANTY	CUSTOMER PAY	COST
LABOR					
PARTS					
DEDUCTIBLE					
SUBLET					
SHOP SUPPLIES					
HAZARDOUS MATERIALS					
SALES TAX OR TAX I.D.					
SPECIAL ORDER DEPOSIT					
DISCOUNTS					

REPAIR ORDER - AUDIT COPY

DEERY BROTHERS
200 S Gear Ave
West Burlington, IA 52655

Work Phone

R/O Open Date

R/O Number

9/11/24

6019850/2

Home Phone

R/O Close Date

Receipt No.

9/19/24

Original

Body

Mileage In

Mileage Out

SL 4WD

35672

35672

License Number

Service Advisor

JAKE BACHTTELL

Account No.

Delivery Date

In-Service Date

Year

Make

Model

2022

NISSAN

PATHFINDER

Vehicle Identification Number

Color

5N1DR3CC8NC203833

RED

INVENTORY: 964680

REPLACEMENT

Corrected by AF: REPLACED ENGINE AIR FILTER

Work performed by Tech 490/ * 0.10hrs

165466TA0A : AIR CLEANER ELEMENT

1@29.95

10.00

29.95

REPLACED FILTER

#7 * 4T: REPLACE 4 TIRES - MOUNT & BALANCE 4 TIRES . INCLUD
ED WITH THE PURCHASE OF THESE TIRES - ORIGINAL OWN
ER WILL RECEIVE TIRE ROTATION FOR LIFE OF TIRE ON
ORIGINAL VEHICLE TIRES WERE PURCHASED FOR DOWN TO
Corrected by 4T: REPLACE 4 TIRES - MOUNT & BALANCE 4
TIRES . INCLUD ED WITH THE PURCHASE OF THESE TIRES
- ORIGINAL OWN ER WILL RECEIVE TIRE ROTATION FOR
LIFE OF TIRE ON ORIGINAL VEHICLE TIRES WERE
PURCHASED FOR DOWN TO

Work performed by Tech 490/ * 1.20hrs

19472584 : N-H25560189 (05880-BOPCKT)

4@251.89

78.00

1007.56

MOUNTED AND BALANCED FOUR TIRES

#8 * BRACKET: INSTALL LICENSE PLATE BRACKET
Corrected by BRACKET: INSTALL LICENSE PLATE BRACKET
Work performed by Tech 490/ * 0.20hrs
INSTALLED FRONT PLATE BRACKET

22.50

Total Fee Amounts

34.00

	INTERNAL	SERVICE CONT.	WARRANTY	CUSTOMER PAY	COST
LABOR	514.10				
PARTS	1124.86				
DEDUCTIBLE					
SUBLET					
SHOP SUPPLIES	29.99				
HAZARDOUS MATERIALS					
SALES TAX OR TAX I.D.					
SPECIAL ORDER DEPOSIT					
DISCOUNTS					
	1702.95				

Anye

764680
OFF Lease



Experian AutoCheck Report

Report run: 09/04/2024 18:09:07 EDT

2022 Nissan Pathfinder SL

SUV 4D (3.5L V6 SMPT Gasoline)

VIN: 5N1DR3CC8NC203833 ✓
Class: SUV - Large
Country of Assembly: United States
Vehicle Age: 2 year(s)
Last Reported Odometer: 110 (09/15/2021)

One Owner
✓ AutoCheck
Vehicle Usage
Lease



AutoCheck Score

Similar vehicles usually range between 91 and 96

Vehicle History at a Glance



State Title Brand



CLEAN



Auction Brand / Issues



NO ISSUE



Accident / Damage

No Accidents or Damage Reported



NO ISSUE



Open Recall Check



NO OPEN RECALLS



Insurance Loss / Transfer



NO ISSUE



Odometer Check

Last reported odometer
110 (09/15/2021)



NO ISSUE



Certified Pre-Owned



NO CPO INFO AVAILABLE



Service / Repair

2 Service Record(s) Reported



NO ISSUE



Additional History



NO ISSUES REPORTED



This vehicle is eligible for Buyback Protection


Due to the vehicle's history showing no reported major state title brands. Terms & Conditions

[Learn More](#)

Accident & Damage

WATER

Your Vehicle Checks Out AutoCheck has not received any accident or damage-related events from government sources, independent agencies, or auction sources. Not all damage-related events are reported to AutoCheck. It is recommended to have pre-owned vehicles inspected by a third-party prior to purchase.

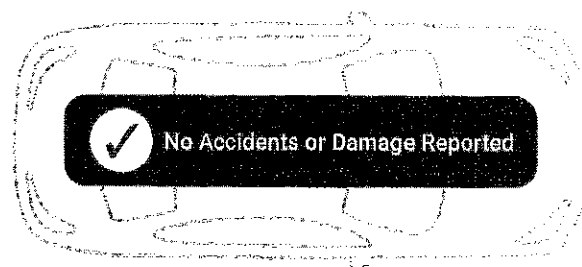

Airbag Deployed



Overturned



Structural Damage



No Damage

Odometer Check



Your Vehicle Checks Out

No odometer brands, rollbacks, rollover or tampering has been reported to AutoCheck from state Division of Motor Vehicles (DMV) or auction sources. AutoCheck also examined the sequence of reported odometer readings to determine if there are any potential discrepancies.



State Title Odometer Check

No issues reported



Auction Odometer Check

No issues reported



Odometer Calculation Check

No issues reported

Detailed Vehicle History

Below are the historical events for this vehicle listed in chronological order.

Vehicle: 2022 Nissan Pathfinder SL (

5N1DR30C8NC203833

) Report Run Date: 09/04/2024 18:09:07 EDT

2021

Vehicle Prep and Other Pre-Titling Events

Preparation Date: 06/2021

Event Date	Location	Odometer	Data Source	Details
06/18/2021			Independent Source	Vehicle Manufactured and Shipped to Dealer
07/20/2021	FLORENCE, KY	2	Service Record	Multiple Point Vehicle Inspection Tires or Wheels Service Performed
07/28/2021	FLORENCE, KY	7	Service Record	Vehicle Serviced

2021

Owner 1

Location: OH

Owned From: 09/2021

Usage: Lease

Event Date	Location	Odometer	Data Source	Details
09/15/2021	OH	110	Motor Vehicle Dept.	Title
09/18/2021	WAYNESVILLE, OH		Motor Vehicle Dept.	Registration Event/Renewal(Leased Vehicle)

Event Date	Location	Odometer	Data Source	Details
07/18/2022	WAYNESVILLE, OH		Motor Vehicle Dept.	Registration Event/Renewal(Leased Vehicle)
07/24/2023	WAYNESVILLE, OH		Motor Vehicle Dept.	Registration Event/Renewal(Leased Vehicle)

AutoCheck Terms and Conditions

This report, and any reliance upon it, is subject to **AutoCheck Terms and Conditions**. If you obtained the report from a lender/dealer, the lender/dealer has been provided with these Terms and Conditions and can share them with you. These AutoCheck Terms and Conditions are also available at any time at www.autocheck.com/terms or by writing to Experian: Experian Automotive C/O AutoCheck Customer Service 1515 E. Woodfield Road, Suite 500, Schaumburg, IL 60173.

Buyback Protection Terms and Conditions

This vehicle (

SN1DR3CC8HC203833 

) qualifies for **AutoCheck Buyback Protection**. If you obtained the report from a dealer, the dealer has been provided with the terms and can share them with you. These Buyback Protection Terms and Conditions are also available to you at any time at www.autocheck.com/bbptterms or by writing to Experian: Experian Automotive C/O AutoCheck Customer Service 1515 E. Woodfield Road, Suite 500, Schaumburg, IL 60173.

About AutoCheck

AutoCheck vehicle history reports by Experian Automotive is the leading vehicle history reporting service. With expert data handling, the Experian Automotive database houses over 4 billion records on a half a billion vehicles. Every AutoCheck vehicle history report will give you confidence when buying or selling your next used vehicle, with superior customer service every step of the way.

Patent Notice

Certain aspects of this vehicle history report may be covered by U.S. Patent 8,005,759.



DBS National Service History

National Service History

Campaigns (TSB/Recalls)	No Active Campaigns	Stop Sale Records	No Stop Sale Records Found.
TSB	90 Active TSB(s)	Warranty Extension	No Warranty Extension Records
Warranty Exclusion	No Warranty Exclusions Records	Branded Title	No Branded Title Found
Service Contracts	No Active Service Contracts		

Vehicle Detail

VIN	
Model Year	2022
Make	NISSAN
Model Name	PATHFINDER
Model Code	25412
Model	PATHFINDER SL 4WD
Exterior Color	NBL-SCARLET EMBER T
Interior Color	G-CHARCOAL
Fuel Type	coming soon...
Link Status	coming soon...
Link Name	coming soon...
Seller By	MATT CASTRUCCI NISSA DAYTON ,OH
Acquire Date	08/28/2021
Vehicle Order Date	06/15/2021
PPH Code	
PGF Code	PGF
Warranty Cover Code	Yes
Initial Package Code	
Last Service Date	07/31/2023
Last Service Odometer	11,558 mi

Warranty Coverage Information

Warranty Type	Expiration Date	Expiration Odometer
ADJUSTMENTS	08/28/2022	12,000
OUTER TRIM CORROSION	08/28/2022	12,500
REFRIGERANT RECHARGE ONLY	08/28/2022	999,999
FEDERAL EMISSIONS PERFORMANCE	08/28/2023	24,000
BASIC COVERAGE	08/28/2024	36,000
FEDERAL EMISSION DEFECT	08/28/2024	36,000
CALIFORNIA EMISSION DEFECT	08/28/2024	50,000

POWERTRAIN COVERAGE	08/28/2026	60,000
CORROSION COVERAGE (PERFORATION)	08/28/2026	999,999
CALIFORNIA EMISSION LONG TERM DEFEC	08/28/2028	70,000
FEDERAL EMISSION LONG TERM DEFECT	08/28/2029	80,000
SEAT BELT	08/28/2031	999,999

Repair Order Information

RO#	Order Date	Close	Dealer/Service Advisor	Overnighted	Job Miles	Customer Pay Total	Warranty Pay Total	Internal Pay Total
922468	07/31/2023	07/31/2023	MATT CASTRUCCI NISSAN/ Brandon,Raughton	11,558	2	\$0.00	\$0.00	\$0.00

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
1	Warranty Pay			99NIZ1RECALL	PERFORM CAMPAIGN	

Customer Complaint	Customer Description	Correction Statement
PATH AC PIPE INSP NTB22-059 -- FOR MISSING PART	OPEN RECALL	INSPECTED AC PIPE (OK) CORRECTION FOR MISSING PART.

Part Number	Part Description	Part Quantity	Part Cost
620906TA0B	ABSORBER-ENERGY	1	\$123.89

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
2	Customer Pay			11NIZZMPI	MPI	

Customer Complaint	Customer Description	Correction Statement
PERFORM NISSAN MULTI-POINT INSPECTION		

RO#	Order Date	Close	Dealer/Service Advisor	Overnighted	Job Miles	Customer Pay Total	Warranty Pay Total	Internal Pay Total
921513	07/19/2023	07/20/2023	MATT CASTRUCCI NISSAN/ Brandon,Raughton	11,558	3	\$0.00	\$0.00	\$0.00

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
1	Warranty Pay			99NIZ1RECALL	PERFORM CAMPAIGN	

Customer Complaint	Customer Description	Correction Statement
PATH RR DR HNG BLT NTB21-091	OPEN RECALL	REPLACED REAR-DOOR LOWER HINGE BOLTS

Part Number	Part Description	Part Quantity	Part Cost
01121A8131	BOLT HEX	2	\$2.72

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
2	Warranty Pay			99NIZ2RECALL	RECALL/CAMPAIGN	

Customer Complaint	Cause Description	Correction Statement
PATH AC PIPE INSP NTB22-059	OPEN RECALL	INSPECTED AC PIPE (OK)

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
3	Customer Pay			11NIZZMPI	MPI	

Customer Complaint	Cause Description	Correction Statement
PERFORM NISSAN MULTI-POINT INSPECTION		

Row	Created	Closed	Dealer/Service Advisor	Production	Job	Customer Pay Total	Warranty Pay Total	Internal Pay Total
892601	07/25/2022	07/28/2022	MATT CASTRUCCI NISSAN/ Brandon,Raughton	10,558	7	\$0.00	\$0.00	\$0.00

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
1	Warranty Pay			99NIZ1RECALL	PERFORM CAMPAIGN	

Customer Complaint	Cause Description	Correction Statement
PATH RR DR HNG BLT NTB21-091	OPEN RECALL	COMPLETE

Part Number	Part Description	Part Quantity	Part Cost
01121A8131	BOLT HEX	2	\$2.66

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
2	Warranty Pay			99NIZ2RECALL	RECALL/CAMPAIGN	

Customer Complaint	Cause Description	Correction Statement
PATH 3RD RW ST HDRT NTB21087	OPEN RECALL	COMPLETE

Part Number	Part Description	Part Quantity	Part Cost
864106TA1A	HEAD REST-3RD S	1	\$390.91

864806TA1A

HEAD REST-3RD S

2

\$781.82

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
----------	----------	----------	----------	----------------	-----------------------	-----------------

3 Internal Pay 99NIZ3RECALL PERFORM RECALL

Customer Complaint	Call Description	Correction Statement
--------------------	------------------	----------------------

PATH AC CONDSR PIPE
NTB22059

PARTS ON BACK ORDER

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
----------	----------	----------	----------	----------------	-----------------------	-----------------

4 Warranty Pay 99NIZ9 RECALL

Customer Complaint	Call Description	Correction Statement
--------------------	------------------	----------------------

PATH ECM REPRO NTB21-079

OPEN RECALL

PERFORMED RECALL

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
----------	----------	----------	----------	----------------	-----------------------	-----------------

5 Customer Pay 11NIZ01 OIL LUBE AND FILTER

Customer Complaint	Call Description	Correction Statement
--------------------	------------------	----------------------

CUSTOMER REQUESTS: LUBE,
OIL AND FILTER CHANGE.
INCLUDES: UP TO 5 QTS OF
PREMIUM OIL, LUBE AND
NISSAN OIL FILTER.

PER RECOMMENDED
MAINTENANCE.

COMPLETED.

Part Number	Part Description	Quantity	Part Cost
11026JA00A	WASHER DRAIN	1	\$0.00
1520865F0E	OIL FILTER	1	\$0.00
65F	OIL CHANGE	1	\$9.98

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
----------	----------	----------	----------	----------------	-----------------------	-----------------

6 Customer Pay 11NIZ03 TIRE ROTATION

Customer Complaint	Call Description	Correction Statement
--------------------	------------------	----------------------

CUSTOMER REQUESTS: TIRE
ROTATION / FRONT TO BACK.
USE MODIFIED X-PATTERN
RECOMMENDED FOR
PATHFINDERS, QUESTS, AND
XTERRAS.

PER RECOMMENDED
MAINTENANCE.

COMPLETED

Job Line	Pay Type	Goodwill	Job Code	Operation Code	Operation Description	Technical Notes
----------	----------	----------	----------	----------------	-----------------------	-----------------

7	Customer Pay	11NIZZMPI	MPI
Customer Complaint		Cause Description	Correction Statement
PERFORM NISSAN MULTI-POINT INSPECTION			

RO #	Created	Closed	Dealer/Service Advisor	Open Miles	Job Miles	Customer Pay Total	Warranty Pay Total	Internal Pay Total
868382	08/20/2021	08/20/2021	MATT CASTRUCCI NISSAN/ Andrew Meyer	102	2	\$0.00	\$0.00	\$0.00

Job Line	Pay Type	Goodwill	Job Code	Description	Open Miles	Technical Notes
1	Warranty Pay		99NIRECALL	RECALL		

Customer Complaint		Cause Description	Correction Statement
PC818 PATHFNDR SCNDRY HOOD LTC DLR		PASSED INSPECTION PC8180	

Job Line	Pay Type	Goodwill	Job Code	Description	Open Miles	Technical Notes
2	Customer Pay		11NIZZMPI	MPI		

Customer Complaint		Cause Description	Correction Statement
PERFORM NISSAN MULTI-POINT INSPECTION			

RO #	Created	Closed	Dealer/Service Advisor	Open Miles	Job Miles	Customer Pay Total	Warranty Pay Total	Internal Pay Total
539433	07/28/2021	07/30/2021	KERRY NISSAN, INC./ KATIE, MACHUTA	7	1	\$0.00	\$0.00	\$0.00

Job Line	Pay Type	Goodwill	Job Code	Description	Open Miles	Technical Notes
A	Warranty Pay		RECALL	PC8170		performed quality action campaign bulletin for rear door hinge bolt replaced bolts and painted and clear coated and returned back to lot

Customer Complaint		Cause Description	Correction Statement
--------------------	--	-------------------	----------------------

CHECK FOR OPEN RECALL		rear door hinge bolt	
-----------------------	--	----------------------	--

Part Number	Part Description	Part Quantity	Part Cost
-------------	------------------	---------------	-----------

01121A8131

BOLT HEX

2

\$2.16

Job #	Order #	Order Date	Order / Service Advisor	Order Qty	Job #	Order Qty	Warranty Pay Total	Internal Pay Total
538810	07/20/2021	07/22/2021	KERRY NISSAN, INC./ KATIE, MACHUTA	2	3	\$0.00	\$0.00	\$0.00
Job #	Pay Type	Code	Pay Code	Pay Description	Pay Description	Pay Description	Technical Notes	
A	Warranty Pay			PDI	PRE-DELIVERY INSPECTION	PRE-DELIVERY INSPECTION		
Customer Complaint			Repair Description			Correction Statement		
PRE-DELIVERY INSPECTION			PDI					
Job #	Pay Type	Code	Pay Code	Pay Description	Pay Description	Pay Description	Technical Notes	
B	Internal Pay			MISC	APPLIED WHEEL LOCKS	INSTALLED WHEEL LOCKS		
Customer Complaint			Repair Description			Correction Statement		
APPLY WHEEL LOCKS								
Part Number	Part Description	Part Quantity	Part Cost					
999W2JT000	WHEEL LOCK	1	\$70.00					
Job #	Pay Type	Code	Pay Code	Pay Description	Pay Description	Pay Description	Technical Notes	
C	Warranty Pay			RECALL	PC816	REPROGRAMMED ECM		
Customer Complaint			Repair Description			Correction Statement		
CHECK FOR OPEN RECALL			CAMPAIGN ON THE ECM REPROGRAM					